

Last Modified: 12-21-2017	6.8:8.0.48	Doc ID: RM100000000T321
Model Year Start: 2016	Model: LX570	Prod Date Range: [09/2015 -]
Title: AXLE AND DIFFERENTIAL: REAR AXLE SHAFT: INSPECTION; 2016 - 2018 MY LX570 [09/2015 -]		

INSPECTION

PROCEDURE

1. INSPECT REAR AXLE SHAFT LH

- (a) Using a dial indicator, measure the rear axle shaft runout and flange runout.

Maximum runout:


Shaft runout

1.50 mm (0.0591 in.)

Flange runout

0.05 mm (0.00197 in.)

If the rear axle shaft or flange is damaged or worn, or if the runout is more than the maximum, replace the rear axle shaft.

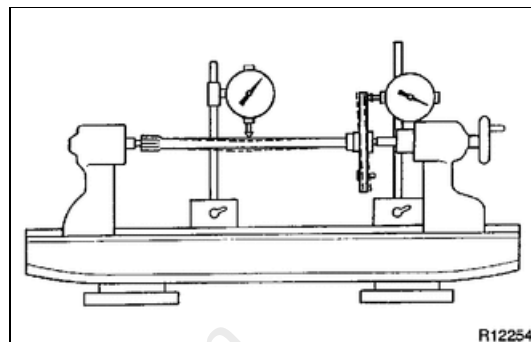

transmissionmanuals.com