


2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

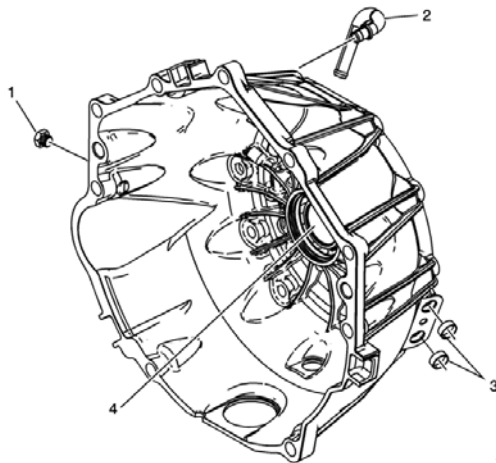

Torque Converter Housing Cleaning and Inspection

Callout	Component Name
Preliminary Procedures	

1. Thoroughly clean the torque converter housing assembly, including threads, with clean solvent.
2. Clean sealing surfaces.
3. Inspect all threaded holes. If necessary, repair any thread damage.

Line Pressure Test Hole Plug

Caution: Use care when tightening the line pressure test hole plug. Do not use a socket extension, which could cause side-loading and potentially crack the transmission case assembly.

- | | |
|---|--|
| 1 | Caution: Refer to Fastener Caution. |
|---|--|

Tighten

11 Y (97 lb in)

- | | |
|---|-------------------|
| 2 | A/Trans Vent Pipe |
|---|-------------------|

Trans Fluid Cooler Pipe Fitting Seal

- | | |
|---|--|
| 3 | Caution: Refer to Seal Reuse Caution. |
|---|--|

Note: Refer to Transmission Fluid Cooler Pipe Seal Replacement.

- | | |
|---|--------------------------|
| 4 | Torque Converter Bushing |
|---|--------------------------|