


2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

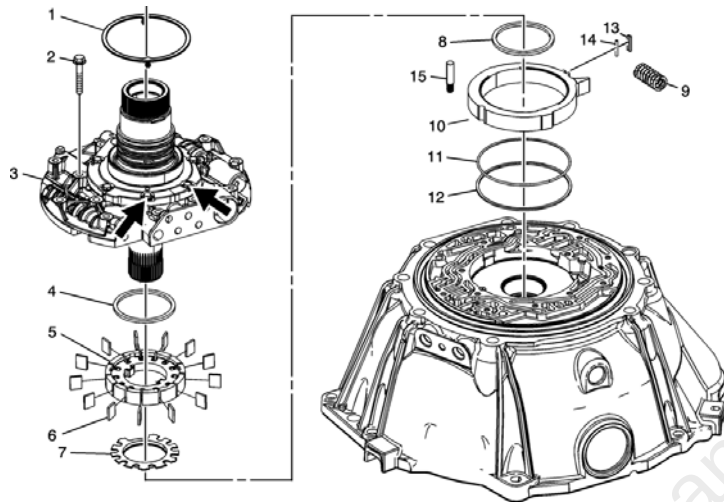

Torque Converter Housing with Fluid Pump Disassemble

Callout

Component Name

Caution: Do not loosen or remove the 6 bolts securing the clutch support to the pump cover assembly. These bolts have been installed and torqued only after specific clutch support rotational requirements have been met. If the clutch support is not installed properly, damage to the transmission will occur.

- | | |
|----|--|
| 1 | 1-2-3-4 and 3-5 Reverse Clutch Housing Thrust Washer |
| 2 | Bolt M6 x 40 (Qty: 13) |
| 3 | Fluid Pump Cover Assembly |
| 4 | Fluid Pump Vane Ring |
| 5 | Fluid Pump Rotor |
| 6 | Fluid Pump Vanes (Qty: 13) |
| 7 | Fluid Pump Rotor Guide |
| 8 | Fluid Pump Vane Ring |
| 9 | Fluid Pump Slide Outer Spring |
| 10 | Fluid Pump Slide |
| 11 | Fluid Pump Slide (O-Ring) Seal |
| 12 | Fluid Pump Slide Fluid Seal Ring |
| 13 | Fluid Pump Slide Seal |
| 14 | Fluid Pump Slide Seal Support |
| 15 | Fluid Pump Slide Pivot Pin |