


2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

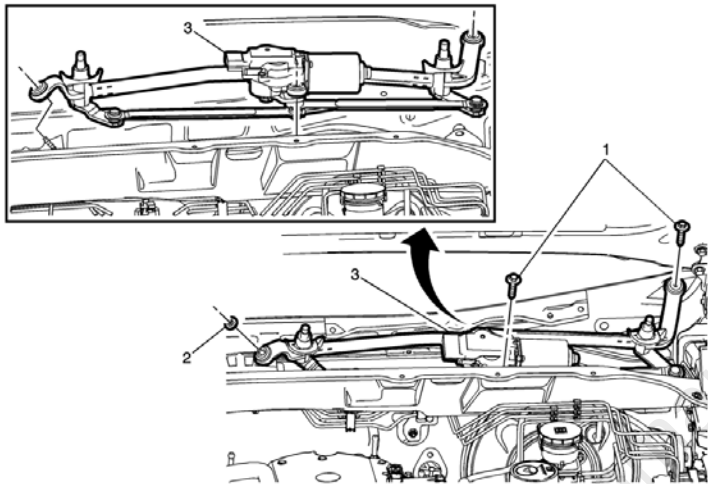

Windshield Wiper Transmission Replacement

Callout	Component Name
Preliminary Procedure	
Remove the air inlet grille panel. Refer to Air Inlet Grille Panel Replacement.	
Windshield Wiper Transmission Bolt (Qty: 2)	
1	Caution: Refer to Fastener Caution.
	Tighten
	5 Y (44 lb in)
Windshield Wiper Transmission Nut	
2	Procedure
	Tighten
	5 Y (44 lb in)
Windshield Wiper Transmission	
3	Procedure
	1. Disconnect the electrical connector from the wiper motor.
	2. Rotate the rearward edge of the transmission from the wiper unit brackets.
	3. Lift the wiper transmission assembly upward and rotate the wiper transmission forward out of the plenum.
	4. Remove the wiper transmission assembly from the vehicle.
	5. Remove and transfer the windshield wiper motor, if needed. Refer to Windshield Wiper Motor Replacement.