


Last Modified: 12-21-2017	6.8:8.0.48	Doc ID: RM100000000T2X2
Model Year Start: 2016	Model: LX570	Prod Date Range: [09/2015 -]
Title: AE80F AUTOMATIC TRANSMISSION / TRANSAXLE: PARK / NEUTRAL POSITION SWITCH: ADJUSTMENT; 2016 - 2018 MY LX570 [09/2015 -]		

ADJUSTMENT PROCEDURE

1. ADJUST PARK/NEUTRAL POSITION SWITCH ASSEMBLY


- (a) Loosen the 2 bolts of the park/neutral position switch assembly and move the shift lever to N.

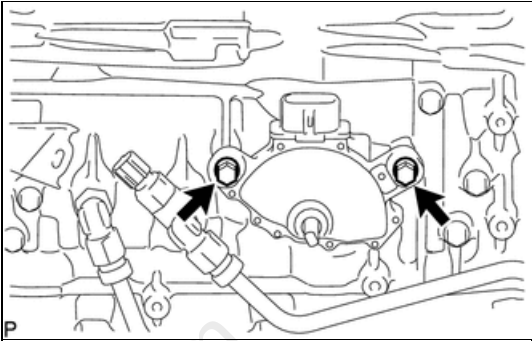

- (b) Align the groove with the neutral basic line.

Text in Illustration

*a	Neutral Basic Line
*b	Groove

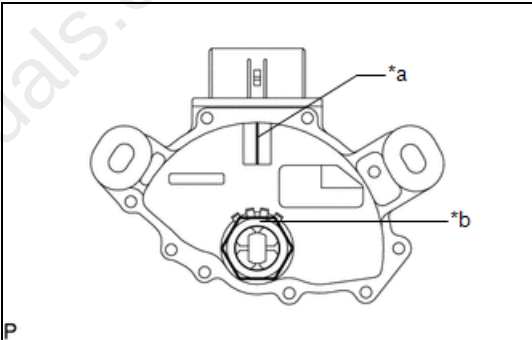

- (c) Hold the switch in the position described above and tighten the 2 bolts.

Torque:

5.4 N·m {55 kgf·cm, 48 in·lbf}

- (d) After the adjustment, perform the on-vehicle inspection (See page [INFO](#)).